

Blue

Work Order ID 108927

108927

Page 1

October-29-13 10:40:48 AM

Item ID: D206-667-207BL

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 11/15/13 Req'd Qty: 1.00 *1*

Customer:

Reference:

Run Start *NR1*

Approvals: Process Plan: MCS Date: 13-10-29 Tooling: _____ Date: _____

Stop *NR2*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D206-667-247

A (DEO)

IIN-D206-667

D

0.00

100

100

DOCUMENT CONTROL

0.00

DC

Memo

Document Control

Photocopy bluefile and create labels as per PPP D206-667-207 chg 002

0.00

110

110

BENDING MACHINE - CROSSTUBES

0.00

CNC Bend 2

Memo

CNC Alpha 160 Bender

Bend tube as per Dwg D206-667-247 using CNC bender program D206-667-207

600 S40
13/12/13

mhj

Pto →

JW 13-10-30

DQA:

Date:

13/12/19

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed:

Date:

13/12/18

Work Order update only ☐

Work Order: <u>108927</u>	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS			
Part No. <u>D206-667-207BL</u>		Skid-tube <input type="checkbox"/>	Crosstube <input checked="" type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>
NCR No. <u>13-3840</u>		Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>
		Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>
		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling	13/10/31	110	1	CRUSHING IS OVER tolerance	DAS 12 9-89 13/10/31	Acceptable. Location is not critical. Ref attached S.R.	DAS 12 9-89 13/10/31	DAS 16 9-89 13/10/31	DAS 16 9-89 13/10/31
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input checked="" type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
---	--	---	--	--

October-29-13 10:40:48 AM

Page 2

[illegible]

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design -									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 108927

108927

Page 3

October-29-13 10:40:48 AM

Item ID: D206-667-207BL

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/15/13 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start

NR1

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130

0.00

130

Crosstubes

Crosstubes

Memo

0.00

***** ENSURE PROPER JIG POSITIONING BEFORE DRILLING*****
VERIFIED BY: MD *****

1-Drill pilot holes in tube using drill Jig DT8583 & DT8584 as per Dwg D206-667-247. Drill all (3) top holes. Holes facing inboard. Drill and Ream all holes in tube to finish size using drill Jig DT8583 & DT8584 as per Dwg D206-667-247

***** ENSURE PROPER JIG POSITIONING BEFORE DRILLING*****
VERIFIED BY: MD *****

2- Drill fwd rivet holes using drill Jig DT8787 fwd as per Dwg D206-667-247.
Note: FWD side has 3X top holes facing inboard.

3- C'sink holes as per dwg D206-667-247. Allow rivet to sit below surface to compensate for paint.

4- Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins. Drill ONLY 2 top holes ONLY plug most bottom hole to prevent accidental drilling. Drill holes and ream using drill Jig DT8583 & DT8584 as per Dwg D206-667-247. Drill only the top (2) holes. Drill & ream the top (2) holes to finish size using drill Jig DT8583 & DT8584 as per Dwg D206-667-247

***** ENSURE PROPER JIG POSITIONING BEFORE DRILLING*****
VERIFIED BY: MD *****

5-Drill aft rivet holes using drill Jig DT8787 aft as per Dwg D206-667-247.

MD / 13/11/05
gmm ✓

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 108927

108927

Page 4

October-29-13 10:40:48 AM

Item ID: D206-667-207BL

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 11/15/13 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start *NR1*

QC: Date: SPC (Y/N): Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Drill only the top (2) holes.

***** ENSURE PROPER JIG POSITIONING BEFORE DRILLING*****
VERIFIED BY: MO *****

6- C'sink holes as per dwg D206-667-247. Allow rivet to sit below surface to compensate for paint.

7- Scribe tube to identify on the inner chamfer in the cuff D# and B#

8-*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***Debur & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-247

140

QC5- Inspect part completeness to step on W/O 0.00

140

QC

Quality Control

Memo

0.00

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

DAS

27

9-89

13/11/06

MO/ann 11/05

MO 13/11/06

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 108927

108927

Page 5

October-29-13 10:40:48 AM

Item ID: D206-667-207BL

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/15/13 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Run Start ***NR1***

Stop ***NR2***

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150

0.00

150

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

1- CLEAN CROSSTUBE WITH WASH'N WIPE

1 0 0 13-11-7

170

Outsource process - NDT per QSI038 4.1

0.00

170

Outsource2

Memo

0.00

Outsource process - NDT

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

Liquid Penetrant Inspection as per QSI 038Or

Issue P/O: 21994

LPI as per ASTM 1417

Level 2 Attach copy of NDT results to work order

CL 13/11/08 ①

180

0.00

180

Packaging

Packaging

Memo

0.00

Packaging

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

Ensure copy of NDT results attached to work order.

13/11/08 ①

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 108927

October-29-13 10:40:48 AM

108927

Page 6

Item ID: D206-667-207BL

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/15/13 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start ***NR1***

QC: Date: SPC (Y/N): Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190	QC5- Inspect part completeness to step on W/O	0.00				1			<i>ms</i> 13-11-08
190									
QC	Memo	0.00							
Quality Control	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	Ensure results are as per Dwg D206-667-247								
195		0.00				1	0	0	<i>AB</i>
195									13-11-7
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	1- PRESSURE WASH AND THEN USE WASH'N WIPE TO CLEAN CROSSTUBE BEFORE CHEMICAL CONVERSION								
197	QC7-Inspect Chemical Conversion Coat	0.00				1			<i>ms</i> 13-11-08
197									
QC	Memo	0.00							
Quality Control	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:15%;">Skid-tube <input type="checkbox"/></td> <td style="width:15%;">Crosstube <input type="checkbox"/></td> <td style="width:15%;">Water Jet <input type="checkbox"/></td> <td style="width:15%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 108927***108927***

Page 7

October-29-13 10:40:48 AM

Item ID: D206-667-207BL

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/15/13 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200		0.00							
200	SprayPaint	0.00				1	0	0	AS
SprayPaint	Memo								13-11-14
Spray Painting	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	1-Prime inside and outside crosstube as per QSI 005 4.2								
	2-Paint outside crosstube as per QSI 005 4.2								
	PRIME:								
	Start Time: _____	Primer	126558						
	Finish Time: _____	Paint	126437						
	PAINT:								
	Start Time: _____	clear	121703						
	Finish Time: _____								
210	QC14- Inspect Spray Paint	0.00							
210									
QC	Memo	0.00							
Quality Control	Wrap in plastic bag to protect from scratches								

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 108927

October-29-13 10:40:48 AM

108927

Page 8

Item ID: D206-667-207BL

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/15/13 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start

NR1

QC: Date: SPC (Y/N): Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
220		0.00							
220	Crosstubes					1	0	0	AS
Crosstubes	Memo	0.00							13-11-19
Crosstubes	1-Install nut plates as per Dwg D206-667-247.								
230		0.00							
230	Skidtubes					1	0	0	AS
Crosstubes	Memo	0.00							13-11-27
Crosstubes	1-Abrade mating surfaces of support and crosstube with 400 grit sandpaper, clean the area with 4105S wash 'n' wipe								
	2-Install supports with Proseal 890 per DSI9565 and QSI 015								
	A/R Proseal 890 Batch: <u>126855</u>								
	3- Torque bolts as per dwg <u>exp 5/14</u>								
240		0.00							
240	QC5- Inspect part completeness to step on W/O								
QC	Memo	0.00							
Quality Control									

DA
05/13-12-02

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:33%;"> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </td> <td style="width:33%;"> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </td> <td style="width:33%;"> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </td> <td style="width:33%;"> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </td> </tr> </table>	Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>
Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>			

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 108927

October-29-13 10:40:48 AM

108927

Page 9

Item ID: D206-667-207BL

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/15/13 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Run Start ***NR1***

Stop ***NR2***

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250	Pick Kit	0.00							
250									
Packaging	Memo	0.00							
Packaging									
260	QC4- 100% Inspect kits for completeness	0.00							
260									
QC	Memo	0.00							
Quality Control									
270	Packaging	0.00							
270									
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP D206-667-207								
	Location: <u>053</u>								
	PPP Rev: _____								

DAS
6
9-89

13/12/13

(1)

13/12/14

DAS
6
9-89

2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td style="width: 33%;"> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </td> <td style="width: 33%;"> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </td> <td style="width: 33%;"> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </td> <td style="width: 33%;"> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </td> </tr> </table>	Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>
Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>			

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 108927

108927

Page 10

October-29-13 10:40:48 AM

Item ID: D206-667-207BL

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 11/15/13 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

280

QC21- Final Inspection - Work Order Release

0.00

280

QC

Memo

0.00

Quality Control

[Signature] / Rm 13/12/04

pl 13-12-4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Picklist Print

October-29-13 10:40:46 AM

Page 1/4

Work Order ID: 108927

Parent Item: D206-667-207BL

Parent Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13

Required Date: 11/15/13

Start Qty: 1.00

Required Qty: 1.00

Comments: RevA 11.01.13 New Issue EC verified by:DD
615 DD VERF:EC

IPP REV:B 11.08.08 PER ECN 11-

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
ANS-10A BOLT		Purchased	No			250	Each	353.0000	10	10		M127432	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				GA		50							DAS 26 9-89
				122800		50							
				st503		303							
				M126180		303							
ANS-32A Bolt		Purchased	No			250	Each	271.0000	4	4		M127363	DAS 26 9-89
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				ST337		266							
				124215		266							
				ST350A		5							
				124805		5							DAS 26 9-89
ANS-34A Bolt		Purchased	No			250	Each	62.0000	4	4		13-12-02	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				st503		62							
				m126176		46							
				m126474		16							

DAS
6
9-89

DAS
6
9-89

DAS
6
9-89

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td style="width: 33%;"> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </td> <td style="width: 33%;"> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </td> <td style="width: 33%;"> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </td> <td style="width: 33%;"> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </td> </tr> </table>	Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>
Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>			

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Picklist Print

October-29-13 10:40:47 AM

Page 2

Work Order ID: 108927

Parent Item: D206-667-207BL

Parent Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13

Required Date: 11/15/13

Start Qty: 1.00

Required Qty: 1.00

D206-667-247TRN

Manufactured No

110

Each

8.0000

1

1

Grosstube Assembly, Mid Aft

Location

Loc Qty

Loc Code

LG

6

103529

1

104918

1

104919

1

105213

1

105215

1

105217

1

LG014

2

105214

1

78498

1

D2873-043

Manufactured No

220

Each

66.0000

2

2

Nut/Plate Assembly

Location

Loc Qty

Loc Code

LG052

66

100708

2

103456

1

104877

40

107964

20

72644

2

84386

1

D2873-045

Manufactured No

220

Each

48.0000

2

2

Nut/Plate Assembly

Location

Loc Qty

Loc Code

LG052

48

100418

1

100707

2

103569

5

104870

40

① Em 13-10-30

Ag 13-11-19

Ag 13-11-19

②

②

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Picklist Print

October-29-13 10:40:47 AM

Page 3

Work Order ID: 108927

Parent Item: D206-667-207BL

Start Date: 10/30/13

Required Date: 11/15/13

Parent Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Qty: 1.00

Required Qty: 1.00

D2892-1

Support

Manufactured No

230 Each 24.0000

2

2

At 13-11-27

Location

Loc Qty

Loc Code

LG052

24

103634

10

105652

14

(2)

D3595-063-450

Rubber Cushion

Manufactured No

230 Each 96.7000

4

4

At 13-11-27

Location

Loc Qty

Loc Code

FG

15

88422

5

94274

10

LG

3

105054

3

LG050

54

105557

27

106584

27

LG051

24.7

108056

24

99357

0.7

(4)

MS20601-AD4W10

RIVET

Purchased No

220 Each 159.0000

14

14

At 13-11-19

Location

Loc Qty

Loc Code

LG050

159

M126863

59

M127301

100

(14)

MS21042LS

Nut

Purchased No

250 Each 1,282.0000

4

4

13-12-07

Location

Loc Qty

Loc Code

st507

782

125535

782

ST509

500

m127304

500

4V

DAS 26 9-89

DAS 6 9-89

October-29-13 10:40:47 AM

Shop Packet Print

Page 3

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Picklist Print

October-29-13 10:40:47 AM

Page 4

Work Order ID: 108927

Parent Item: D206-667-207BL

Parent Item Name: Aft Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13

Required Date: 11/15/13

Start Qty: 1.00

Required Qty: 1.00

MS21920-22

Purchased

No

230

Each

114.0000

4

4

Al 13-11-27

Glamp

Location

Loc Qty

Loc Code

LG050

114

125487

5

M126420

19

M126637

50

M127255

40

NAS1149D0563J

Purchased

No

250

Each

5,072.0000

18

18

13-12-02 DAS 26

Washer

Location

Loc Qty

Loc Code

ST294

93

123248

42

123355

12

m125807

39

ST298

91

122452

91

ST510a

4888

m126319

4888

18x

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									


FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence
--	--	---

<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--

DART AEROSPACE LTD		Work Order:	108927
Description: Crosstube Mid Aft (206L)		Part Number:	D206-667-207
Inspection Dwg: D206-667-247 Rev: A		Page 1 of 1	

Required Dimension	Min	Max
Height	18.34	18.60
1/2 Span	41.79	42.05
Angle	54°	56°
Total Span	83.59	84.09
Bending Passes	10	--
Crushing	--	6%

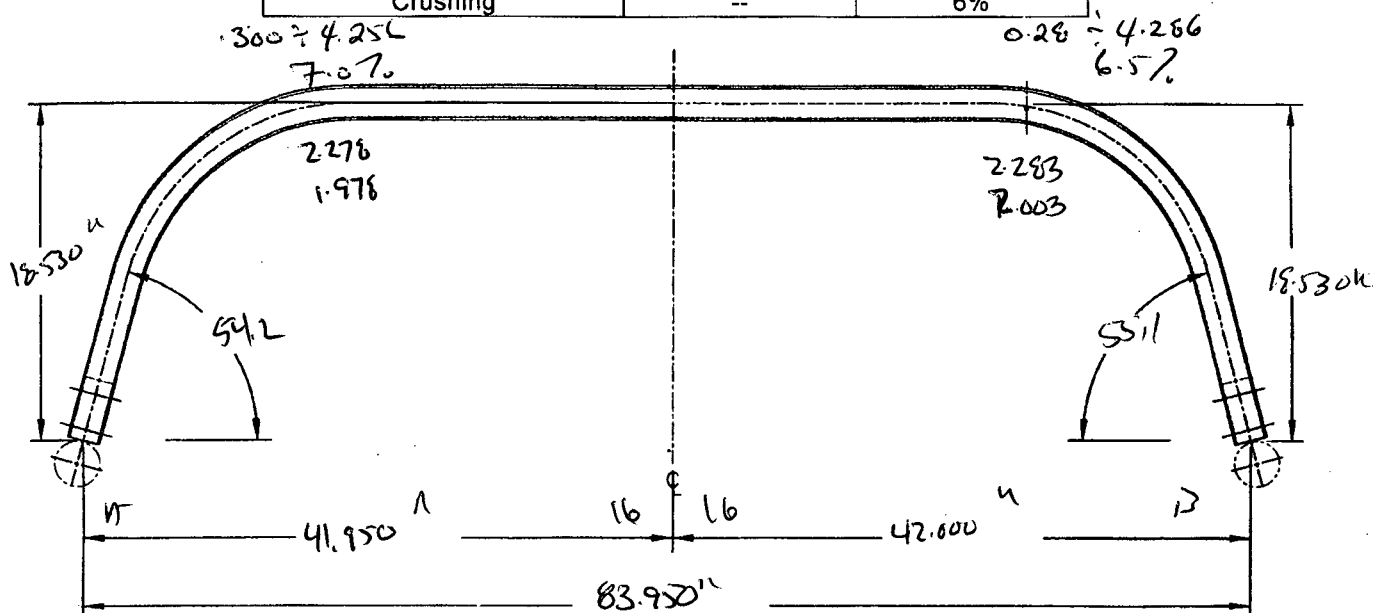

	Side A	Side B
Bending Passes	16	16
Crushing	7.07%	6.57%
Comments		
Side A = 7.07% crush @ 16 Passes		
Side B = 6.57% crushing @ 16 Passes		

QC15 Inspection	DAS
Date	16 9-89 13/10/31

Rev	Date	Change	Revised by	Approved
A	12.02.15	New Issue	KJ	
B	12.04.16	Added bending, crushing dimensions	KJ	

Item	Qty -247	Part Number	Description
1	X	D206-667-247	CROSSTUBE ASSEMBLY (206L MID AFT)
2	1	D6004-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2892-1	SUPPORT
6	4	D3595-063-450	RUBBER CUSHION
7	4	MS21920-22	CLAMP
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6004-115
FINISHED LENGTH = 99.76±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-247" AND BATCH NUMBER ON
INSIDE OF CUFF PER DART QSI 044 6.4 (VIBRATING STYLUS).
- 7) WEIGHT: 21.1 lbs (-607 = 17.7 lbs)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2892-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI
015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-22 CLAMPS WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE
D2892-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE
LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

108927 MLC
13-10-29
DEO ATTACHED

BCW #11-615

11.07.28

UNDER REVIEW


RELEASED
2011-05-24

A	NEW ISSUE	CP	10.12.23
REV.	DESCRIPTION	BY	DATE
DESIGN	90		
DRAWN	90		
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	10.12.23		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D206-667-247	REV. A SHEET 1 OF 4
TITLE CROSSTUBE ASSY (206L MID AFT)	SCALE NTS

COPYRIGHT © 2010 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD

108927

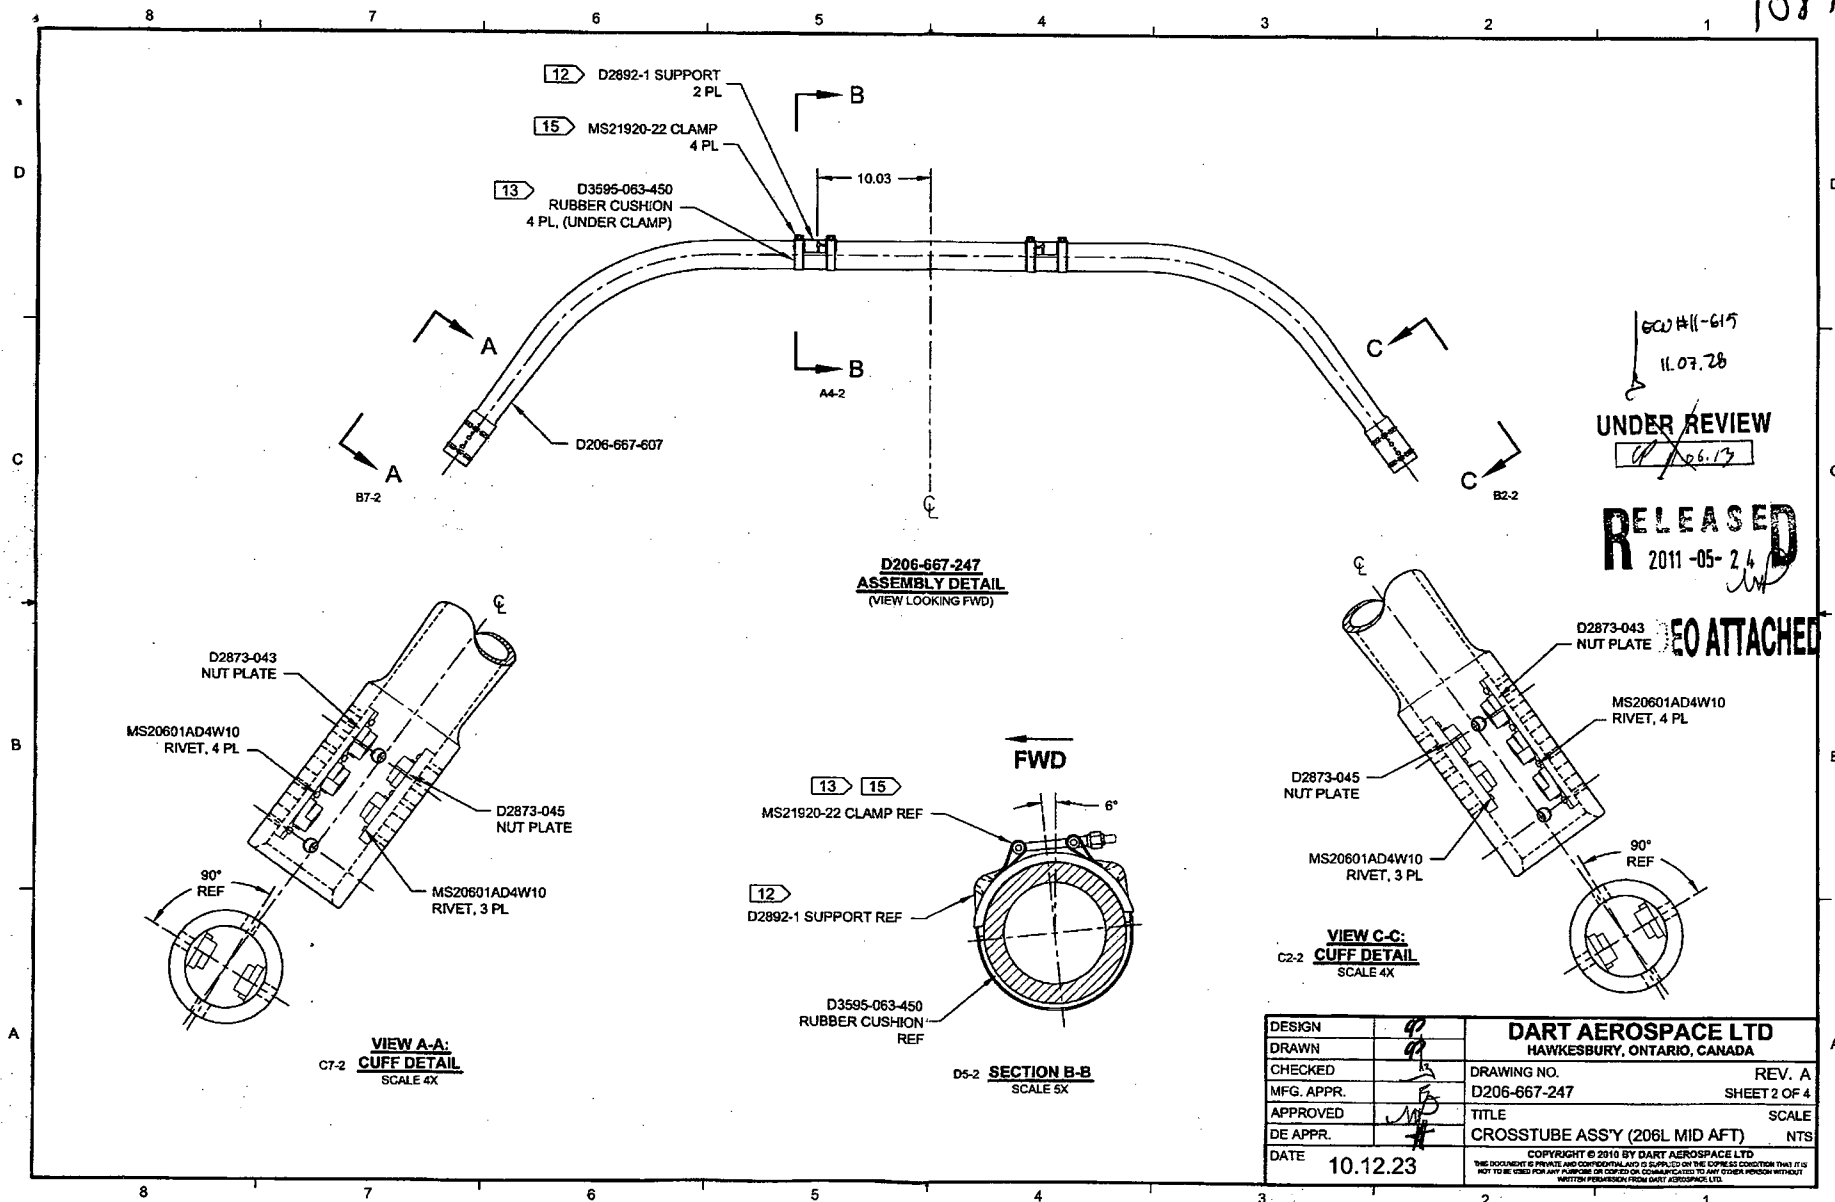

DESIGN		DART AEROSPACE LTD
DRAWN		HAWKESBURY, ONTARIO, CANADA
CHECKED		DRAWING NO. REV. A
MFG. APPR.		D206-667-247 SHEET 2 OF 4
APPROVED		TITLE SCALE
DE APPR.		CROSSTUBE ASS'Y (206L MID AFT) NTS
DATE	10.12.23	COPYRIGHT © 2010 BY DART AEROSPACE LTD


108927

UNDER REVIEW

EQ 11-61
11.07.24


DEO ATTACHED

RELEASED
2011-05-24

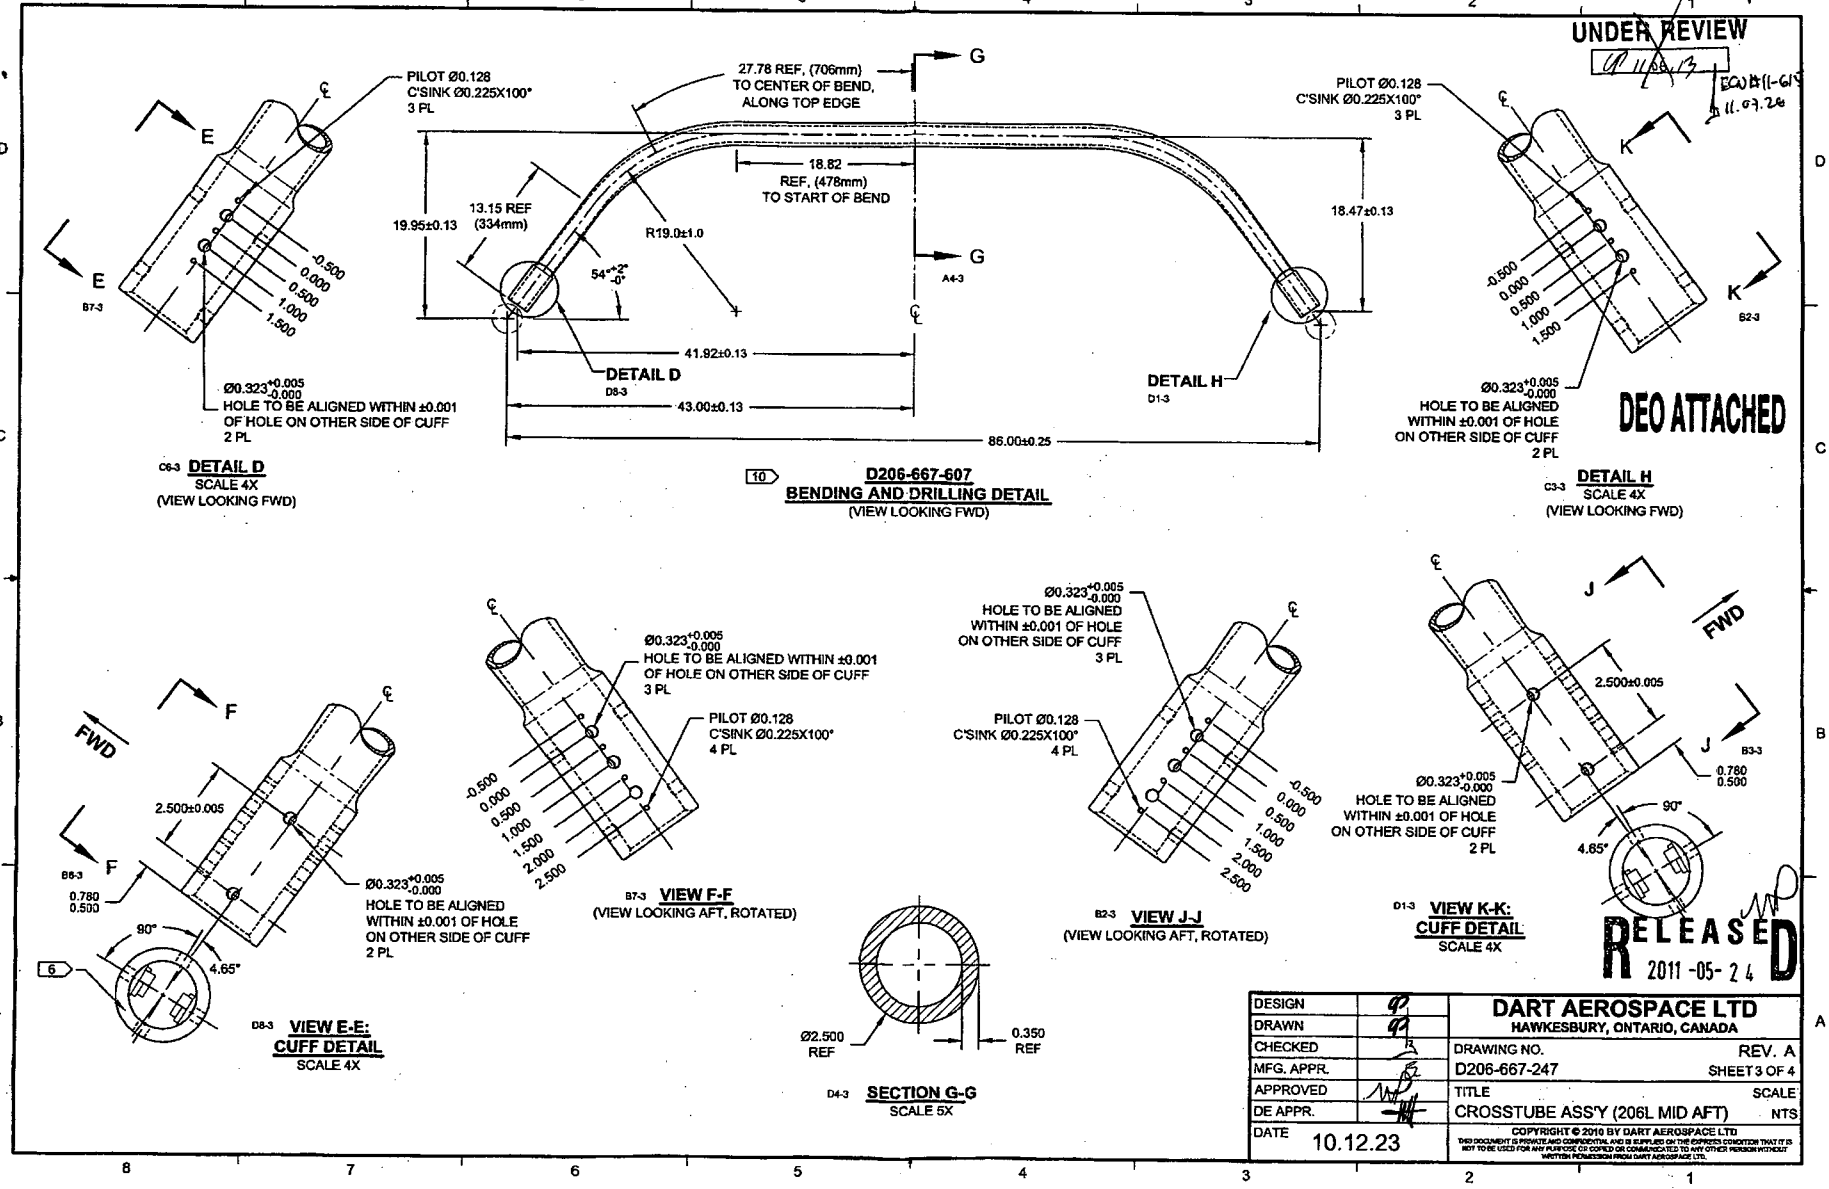


DESIGN	99	DART AEROSPACE LTD	
DRAWN	99	HAWKESBURY, ONTARIO, CANADA	
CHECKED	99	DRAWING NO.	REV. A
MFG. APPR.	99	D206-667-247	SHEET 3 OF 4
APPROVED	99	TITLE	SCALE
DE APPR.	99	CROSSTUBE ASSY (206L MID AFT)	NTS
DATE	10.12.23	COPYRIGHT © 2010 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR COMMERCIAL PURPOSES TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			


108927

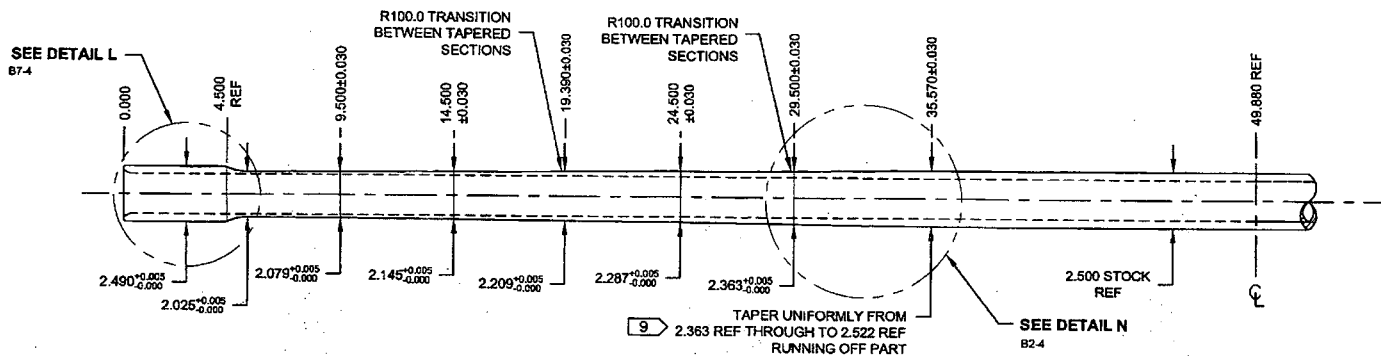


TURNING DETAIL

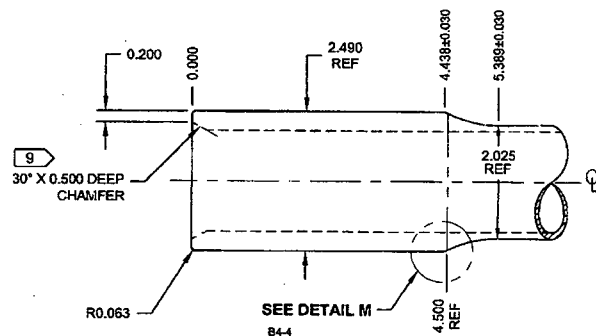

DETAIL L: CROSSTUBE CUFF
SCALE 2.5X

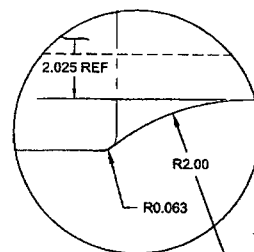

DETAIL M:
CUFF TRANSITION
NOT TO SCALE

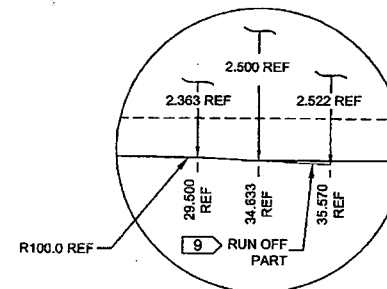

DETAIL N:
TAPER RUN-OFF
NOT TO SCALE

DEO ATTACHED

RELEASED
2011-05-24

DESIGN	90	DART AEROSPACE LTD	
DRAWN	91	HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. A
MFG. APPR.		D206-667-247	SHEET 4 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (206L MID AFT)	NTS
DATE	10.12.23	COPYRIGHT © 2010 BY DART AEROSPACE LTD	

THIS DOCUMENT IS PRELIMINARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

108927

DRAWING NO. D206-667-247	TITLE CROSSTUBE ASS'Y (206L MID AFT)	REV. A	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D206-667-247-A-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN 92	CHECKED ASS	MFG. APPR. KJ	APPROVED JMP	DE APPR. H		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21	DATE 11.7.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -247	Part Number	Description
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2892-1 SUPPORT: ABRABE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2892-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28
M

folio

Dart Aerospace Ltd
Landing Gear
CNC Bender 2
D206-667-247

Batch#: 108927

Tangent lines

Center line

15" from CUFF

19" from Center line

2-Set-up

2.5" Rollers WITH 1.6" Spacers

Buggy A - 3.125"

All programs run with long end of tube on LARGE TABLE

3-BENDING:

Step 1: Y 3290 W 1580

Run program 206247 1-2-3-4 from 19" line down taper, buggy A on Cuff.
then CHECK

Step 2: Y 3340 W 3440

run program 206247 10 (check), 11 - 11a - b - c - d - e , from 15" line


Passes:

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55
56
57
58
59
60
61
62
63
64
65
66
67
68
69
70
71
72
73
74
75
76
77
78
79
80
81
82
83
84
85
86
87
88
89
90
91
92
93
94
95
96
97
98
99
100
101
102
103
104
105
106
107
108
109
110
111
112
113
114
115
116
117
118
119
120
121
122
123
124
125
126
127
128
129
130
131
132
133
134
135
136
137
138
139
140
141
142
143
144
145
146
147
148
149
150
151
152
153
154
155
156
157
158
159
160
161
162
163
164
165
166
167
168
169
170
171
172
173
174
175
176
177
178
179
180
181
182
183
184
185
186
187
188
189
190
191
192
193
194
195
196
197
198
199
200
201
202
203
204
205
206
207
208
209
210
211
212
213
214
215
216
217
218
219
220
221
222
223
224
225
226
227
228
229
230
231
232
233
234
235
236
237
238
239
240
241
242
243
244
245
246
247
248
249
250
251
252
253
254
255
256
257
258
259
260
261
262
263
264
265
266
267
268
269
270
271
272
273
274
275
276
277
278
279
280
281
282
283
284
285
286
287
288
289
290
291
292
293
294
295
296
297
298
299
300
301
302
303
304
305
306
307
308
309
310
311
312
313
314
315
316
317
318
319
320
321
322
323
324
325
326
327
328
329
330
331
332
333
334
335
336
337
338
339
340
341
342
343
344
345
346
347
348
349
350
351
352
353
354
355
356
357
358
359
360
361
362
363
364
365
366
367
368
369
370
371
372
373
374
375
376
377
378
379
380
381
382
383
384
385
386
387
388
389
390
391
392
393
394
395
396
397
398
399
400
401
402
403
404
405
406
407
408
409
410
411
412
413
414
415
416
417
418
419
420
421
422
423
424
425
426
427
428
429
430
431
432
433
434
435
436
437
438
439
440
441
442
443
444
445
446
447
448
449
450
451
452
453
454
455
456
457
458
459
460
461
462
463
464
465
466
467
468
469
470
471
472
473
474
475
476
477
478
479
480
481
482
483
484
485
486
487
488
489
490
491
492
493
494
495
496
497
498
499
500
501
502
503
504
505
506
507
508
509
510
511
512
513
514
515
516
517
518
519
520
521
522
523
524
525
526
527
528
529
530
531
532
533
534
535
536
537
538
539
540
541
542
543
544
545
546
547
548
549
550
551
552
553
554
555
556
557
558
559
560
561
562
563
564
565
566
567
568
569
570
571
572
573
574
575
576
577
578
579
580
581
582
583
584
585
586
587
588
589
590
591
592
593
594
595
596
597
598
599
600
601
602
603
604
605
606
607
608
609
610
611
612
613
614
615
616
617
618
619
620
621
622
623
624
625
626
627
628
629
630
631
632
633
634
635
636
637
638
639
640
641
642
643
644
645
646
647
648
649
650
651
652
653
654
655
656
657
658
659
660
661
662
663
664
665
666
667
668
669
670
671
672
673
674
675
676
677
678
679
680
681
682
683
684
685
686
687
688
689
690
691
692
693
694
695
696
697
698
699
700
701
702
703
704
705
706
707
708
709
710
711
712
713
714
715
716
717
718
719
720
721
722
723
724
725
726
727
728
729
730
731
732
733
734
735
736
737
738
739
740
741
742
743
744
745
746
747
748
749
750
751
752
753
754
755
756
757
758
759
760
761
762
763
764
765
766
767
768
769
770
771
772
773
774
775
776
777
778
779
780
781
782
783
784
785
786
787
788
789
790
791
792
793
794
795
796
797
798
799
800
801
802
803
804
805
806
807
808
809
810
811
812
813
814
815
816
817
818
819
820
821
822
823
824
825
826
827
828
829
830
831
832
833
834
835
836
837
838
839
840
841
842
843
844
845
846
847
848
849
850
851
852
853
854
855
856
857
858
859
860
861
862
863
864
865
866
867
868
869
870
871
872
873
874
875
876
877
878
879
880
881
882
883
884
885
886
887
888
889
890
891
892
893
894
895
896
897
898
899
900
901
902
903
904
905
906
907
908
909
910
911
912
913
914
915
916
917
918
919
920
921
922
923
924
925
926
927
928
929
930
931
932
933
934
935
936
937
938
939
940
941
942
943
944
945
946
947
948
949
950
951
952
953
954
955
956
957
958
959
960
961
962
963
964
965
966
967
968
969
970
971
972
973
974
975
976
977
978
979
980
981
982
983
984
985
986
987
988
989
990
991
992
993
994
995
996
997
998
999
1000
1001
1002
1003
1004
1005
1006
1007
1008
1009
1010
1011
1012
1013
1014
1015
1016
1017
1018
1019
1020
1021
1022
1023
1024
1025
1026
1027
1028
1029
1030
1031
1032
1033
1034
1035
1036
1037
1038
1039
1040
1041
1042
1043
1044
1045
1046
1047
1048
1049
1050
1051
1052
1053
1054
1055
1056
1057
1058
1059
1060
1061
1062
1063
1064
1065
1066
1067
1068
1069
1070
1071
1072
1073
1074
1075
1076
1077
1078
1079
1080
1081
1082
1083
1084
1085
1086
1087
1088
1089
1090
1091
1092
1093
1094
1095
1096
1097
1098
1099
1100
1101
1102
1103
1104
1105
1106
1107
1108
1109
1110
1111
1112
1113
1114
1115
1116
1117
1118
1119
1120
1121
1122
1123
1124
1125
1126
1127
1128
1129
1130
1131
1132
1133
1134
1135
1136
1137
1138
1139
1140
1141
1142
1143
1144
1145
1146
1147
1148
1149
1150
1151
1152
1153
1154
1155
1156
1157
1158
1159
1160
1161
1162
1163
1164
1165
1166
1167
1168
1169
1170
1171
1172
1173
1174
1175
1176
1177
1178
1179
1180
1181
1182
1183
1184
1185
1186
1187
1188
1189
1190
1191
1192
1193
1194
1195
1196
1197
1198
1199
1200
1201
1202
1203
1204
1205
1206
1207
1208
1209
1210
1211
1212
1213
1214
1215
1216
1217
1218
1219
1220
1221
1222
1223
1224
1225
1226
1227
1228
1229
1230
1231
1232
1233
1234
1235
1236
1237
1238
1239
1240
1241
1242
1243
1244
1245
1246
1247
1248
1249
1250
1251
1252
1253
1254
1255
1256
1257
1258
1259
1260
1261
1262
1263
1264
1265
1266
1267
1268
1269
1270
1271
1272
1273
1274
1275
1276
1277
1278
1279
1280
1281
1282
1283
1284
1285
1286
1287
1288
1289
1290
1291
1292
1293
1294
1295
1296
1297
1298
1299
1300
1301
1302
1303
1304
1305
1306
1307
1308
1309
1310
1311
1312
1313
1314
1315
1316
1317
1318
1319
1320
1321
1322
1323
1324
1325
1326
1327
1328
1329
1330
1331
1332
1333
1334
1335
1336
1337
1338
1339
1340
1341
1342
1343
1344
1345
1346
1347
1348
1349
1350
1351
1352
1353
1354
1355
1356
1357
1358
1359
1360
1361
1362
1363
1364
1365
1366
1367
1368
1369
1370
1371
1372
1373
1374
1375
1376
1377
1378
1379
1380
1381
1382
1383
1384
1385
1386
1387
1388
1389
1390
1391
1392
1393
1394
1395
1396
1397
1398
1399
1400
1401
1402
1403
1404
1405
1406
1407
1408
1409
1410
1411
1412
1413
1414
1415
1416
1417
1418
1419
1420
1421
1422
1423
1424
1425
1426
1427
1428
1429
1430
1431
1432
1433
1434
1435
1436
1437
1438
1439
1440
1441
1442
1443
1444
1445
1446
1447
1448
1449
1450
1451
1452
1453
1454
1455
1456
1457
1458
1459
1460
1461
1462
1463
1464
1465
1466
1467
1468
1469
1470
1471
1472
1473
1474
1475
1476
1477
1478
1479
1480
1481
1482
1483
1484
1485
1486
1487
1488
1489
1490
1491
1492
1493
1494
1495
1496
1497
1498
1499
1500
1501
1502
1503
1504
1505
1506
1507
1508
1509
1510
1511
1512
1513
1514
1515
1516
1517
1518
1519
1520
1521
1522
1523
1524
1525
1526
1527
1528
1529
1530
1531
1532
1533
1534
1535
1536
1537
1538
1539
1540
1541
1542
1543
1544
1545
1546
1547
1548
1549
1550
1551
1552
1553
1554
1555
1556
1557
1558
1559
1560
1561
1562
1563
1564
1565
1566
1567
1568
1569
1570
1571
1572
1573
1574
1575
1576
1577
1578
1579
1580
1581
1582
1583
1584
1585
1586
1587
1588
1589
1590
1591
1592
1593
1594
1595
1596
1597
1598
1599
1600
1601
1602
1603
1604
1605
1606
1607
1608
1609
1610
1611
1612
1613
1614
1615
1616
1617
1618
1619
1620
1621
1622
1623
1624
1625
1626
1627
1628
1629
1630
1631
1632
1633
1634
1635
1636
1637
1638
1639
1640
1641
1642
1643
1644
1645
1646
1647
1648
1649
1650
1651
1652
1653
1654
1655
1656
1657
1658
1659
1660
1661
1662
1663
1664
1665
1666
1667
1668
1669
1670
1671
1672
1673
1674
1675
1676
1677
1678
1679
1680
1681
1682
1683
1684
1685
1686
1687
1688
1689
1690
1691
1692
1693
1694
1695
1696
1697
1698
1699
1700
1701
1702
1703
1704
1705
1706
1707
1708
1709
1710
1711
1712
1713
1714
1715
1716
1717
1718
1719
1720
1721
1722
1723
1724
1725
1726
1727
1728
1729
1730
1731
1732
1733
1734
1735
1736
1737
1738
1739
1740
1741
1742
1743
1744
1745
1746
1747
1748
1749
1750
1751
1752
1753
1754
1755
1756
1757
1758
1759
1760
1761
1762
1763
1764
1765
1766
1767
1768
1769
1770
1771
1772
1773
1774
1775
1776
1777
1778
1779
1780
1781
1782
1783
1784
1785
1786
1787
1788
1789
1790
1791
1792
1793
1794
1795
1796
1797
1798
1799
1800
1801
1802
1803
1804
1805
1806
1807
1808
1809
1810
1811
1812
1813
1814
1815
1816
1817
1818
1819
1820
1821
1822
1823
1824
1825
1826
1827
1828
1829
1830
1831
1832
1833
1834
1835
1836
1837
1838
1839
1840
1841
1842
1843
1844
1845
1846
1847
1848
1849
1850
1851
1852
1853
1854
1855
1856
1857
1858
1859
1860
1861
1862
1863
1864
1865
1866
1867
1868
1869
1870
1871
1872
1873
1874
1875
1876
1877
1878
1879
1880
1881
1882
1883
1884
1885
1886
1887
1888
1889
1890
1891
1892
1893
1894
1895
1896
1897
1898
1899
1900
1901
1902
1903
1904
1905
1906
1907
1908
1909
1910
1911
1912
1913
1914
1915
1916
1917
1918
1919
1920
1921
1922
1923
1924
1925
1926
1927
1928
1929
1930
1931
1932
1933
1934
1935
1936
1937
1938
1939
1940
1941
1942
1943
1944
1945
1946
1947
1948
1949
1950
1951
1952
1953
1954
1955
1956
1957
1958
1959
1960
1961
1962
1963
1964
1965
1966
1967
1968
1969
1970
1971
1972
1973
1974
1975
1976
1977
1978
1979
1980
1981
1982
1983
1984
1985
1986
1987
1988
1989
1990
1991
1992
1993
1994
1995
1996
1997
1998
1999
2000
2001
2002
2003
2004
2005
2006
2007
2008
2009
2010
2011
2012
2013
2014
2015
2016
2017
2018
2019
2020
2021
2022
2023
2024
2025
2026
2027
2028
2029
2030
2031
2032
2033
2034
2035
2036
2037
2038
2039
2040
2041
2042
2043
2044
2045
2046
2047
2048
2049
2050
2051
2052
2053
2054
2055
2056
2057
2058
2059
2060
2061
2062
2063
2064
2065
2066
2067
2068
2069
2070
2071
2072
2073
2074
2075
2076
2077
2078
2079
2080
2081
2082
2083
2084
2085
2086
2087
2088
2089
2090
2091
2092
2093
2094
2095
2096
2097
2098
2099
2100
2101
2102
2103

12.01.13

CRUSHING OF D206-667-247

Acceptability of ^{7.3}8% CRUSHING AT END OF BEND

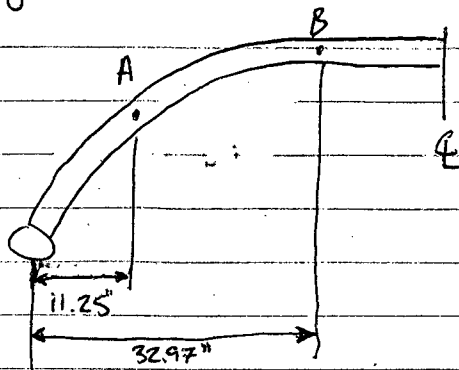

Point A: $OD = 2.283$ $OD2 = 1.973$

$$CRUSHING = (2.283 - 1.973) / (2.283 + 1.973) = 7.3\%$$

$$I = 0.435 \text{ in}^4 \text{ FROM AUTOCAD}$$

Point B: $OD = 2.50 \text{ in}$ $ID = 1.80 \text{ in}$

$$I = 1.402 \text{ in}^4$$

$$A: F = Mc/I = P \times 11.25 \times 1.973 / 2 \times 0.435 = 13.52 P$$

$$B: \quad \quad \quad = P \times 32.97 \times 2.50 / 2 \times 1.402 = 29.39 P$$

$$M.S. = 29.39 / 13.52 - 1 = 1.17$$

∴ Tube will break at support before area of ^{7.3}8% crushing. ^{7.3}8% crushing in area at end of bend is acceptable.

CP 12.01.13

Hilroy



LIQUID PENETRANT TEST REPORT

P- 12254

PAGE 1 OF 1

CLIENT Dart Aerospace DATE Nov 7 2013 TIME AM ☒ PM ☐
ATTENTION Chantale, Linda, Andy ACUREN JOB NO. 188-13-C0393
ADDRESS 1270 Aberdeen St POWO NO. 21994
Hawkesbury, on WORK LOCATION As Address
ACCEPTANCE STD. ASTM 1417/AS1030 REV./DATE 2005
PROJECT PT-wet Fluorescent Liquid Penetrant Inspection
ITEM(S) EXAMINED - See Below

JOB DESCRIPTION PROCEDURE NO. LT-002 REV./DATE 2009 TECHNIQUE NO. LT-002 REV./DATE 2009
PART NO. MATERIAL Aluminium THICKNESS -
SCOPE Performed a wet Fluo L.P.I. on 100% of the external surface only on item mentioned below

TEST DETAILS

METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED
FAMILY BRAND MagnaFlux BLACK LIGHT S/N 3790 ☐ OUTPUT > 1000 μ W/cm² ☐ AMBIENT < 2 fc
PENETRANT ZE-62 MINIMUM DWELL TIME 45 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE
PENETRANT REMOVER H2O MINIMUM DRY TIME >10 MIN. OTHER
DEVELOPER SKD-52 MINIMUM DWELL TIME 30 MIN. LIGHT METER S/N 1098866 CAL DUE DATE May 2014
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY

TEST SURFACE

SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☒ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL
SURFACE TEMPERATURE ☐ < -4°C/ 20°F ☐ -4°C/ 20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- (☐ METRIC ☐ IMPERIAL)

COMMENTS	ACCEPT	REJECT
1 cross tube Mid Aft w.o ID 108442	✓	
2 cross tube Mid Aft w.o ID 108449	✓	
3 Aft cross tube w.o ID 108443	✓	
4 Aft cross tube w.o ID 108700	✓	
5 Aft cross tube w.o ID 108701	✓	
6 Aft cross tube w.o ID 108702	✓	
7 Aft cross tube w.o ID 108705	✓	
8 Aft Mid Height cross tube w.o ID 108707	✓	
9 Aft Mid Height cross tube w.o ID 108920	✓	
No Relevant Indication was detected As per applicable standard at the time of inspection.		
Item ID 0-206-667-207 RL Item ID 0-206-667-207 RL Item ID 0-407-667-205 Item ID 0-407-667-205 Item ID 0-407-667-205 Item ID 0-407-667-205 Item ID 0-407-667-205 Item ID 0-407-667-205 Item ID 0-206-667-207 RL (206/11/13/14/Blue) Item ID 0-206-667-207 RL (206/11/13/14/Blue)		

Scope of Services

The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care

In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE Andy Sheldon DTR # E-07954
TECHNICIAN (SIGNATURE): Alexandre Michaud REPORT REVIEWED BY:
NAME (PRINT): Alexandre Michaud NAME INITIALS
1ST TECHNICIAN 2ND TECHNICIAN
CGSB LEVEL 2 SNT LEVEL 2 CGSB LEVEL SNT LEVEL
CGSB REG. NO. 101418 CGSB REG. NO.

Work Order ID 108927

108927

October-29-13 10:40:48 AM

Item ID: D206-667-207BL

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Alt Mid Height Crosstube 206L/L1/L3/L4, Blue

Start Date: 10/30/13 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/15/13 Req'd Qty: 1.00

1

Customer:

Reference:

Run Start *NR1*

Approvals: Process Plan: *MLJ*

Date: *13-10-29* Tooling:

Date:

QC:

Date: SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D206-667-247

A (DEO)

IIN-D206-667

D

SP

100

0.00

100

DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D206-667-207 chg 002

MLJ 13-12-02

Pto ->

110

0.00

110

BENDING MACHINE - CROSSTUBES

CNC Bend 2

Memo

0.00

CNC Alpha 160 Bender

Bend tube as per Dwg D206-667-247 using CNC bender program D206-667-207